



DRAWING NO. ASY-5671	REVISION REL-02
PROJECT CODE: LICK-51	

Controlled Document
Confirm revision before using

LICK

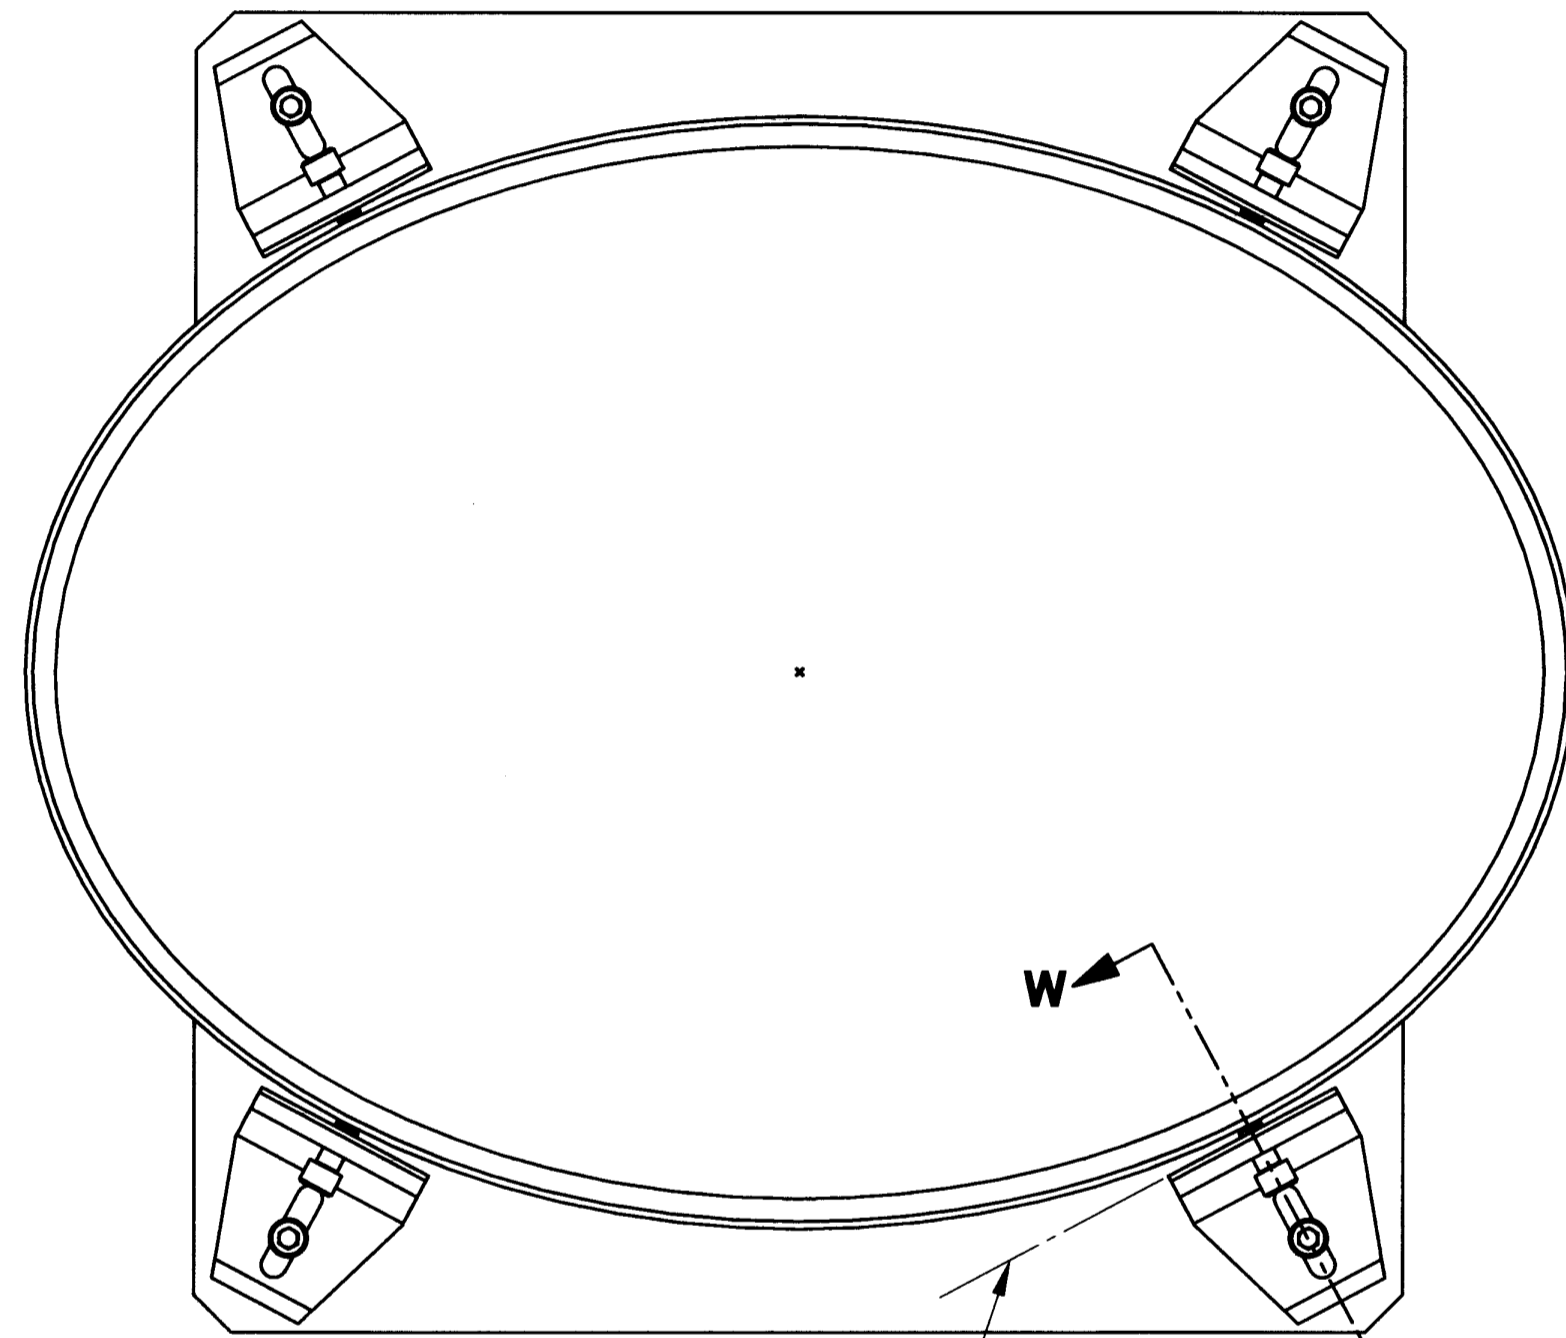


ALIGN THIS SURFACE OF THE ALIGNMENT BRACKET PARALLEL TO THE TANGENT OF THE MIRROR. ALLOW A 2 mm GAP BETWEEN THE MIRROR AND THE BRACKET. TIGHTLY FASTEN THE BRACKET TO THE FIXTURE PLATE BY SECURING THE TIE-DOWN SCREW. (DO NOT USE THREAD-LOCKING COMPOUND)

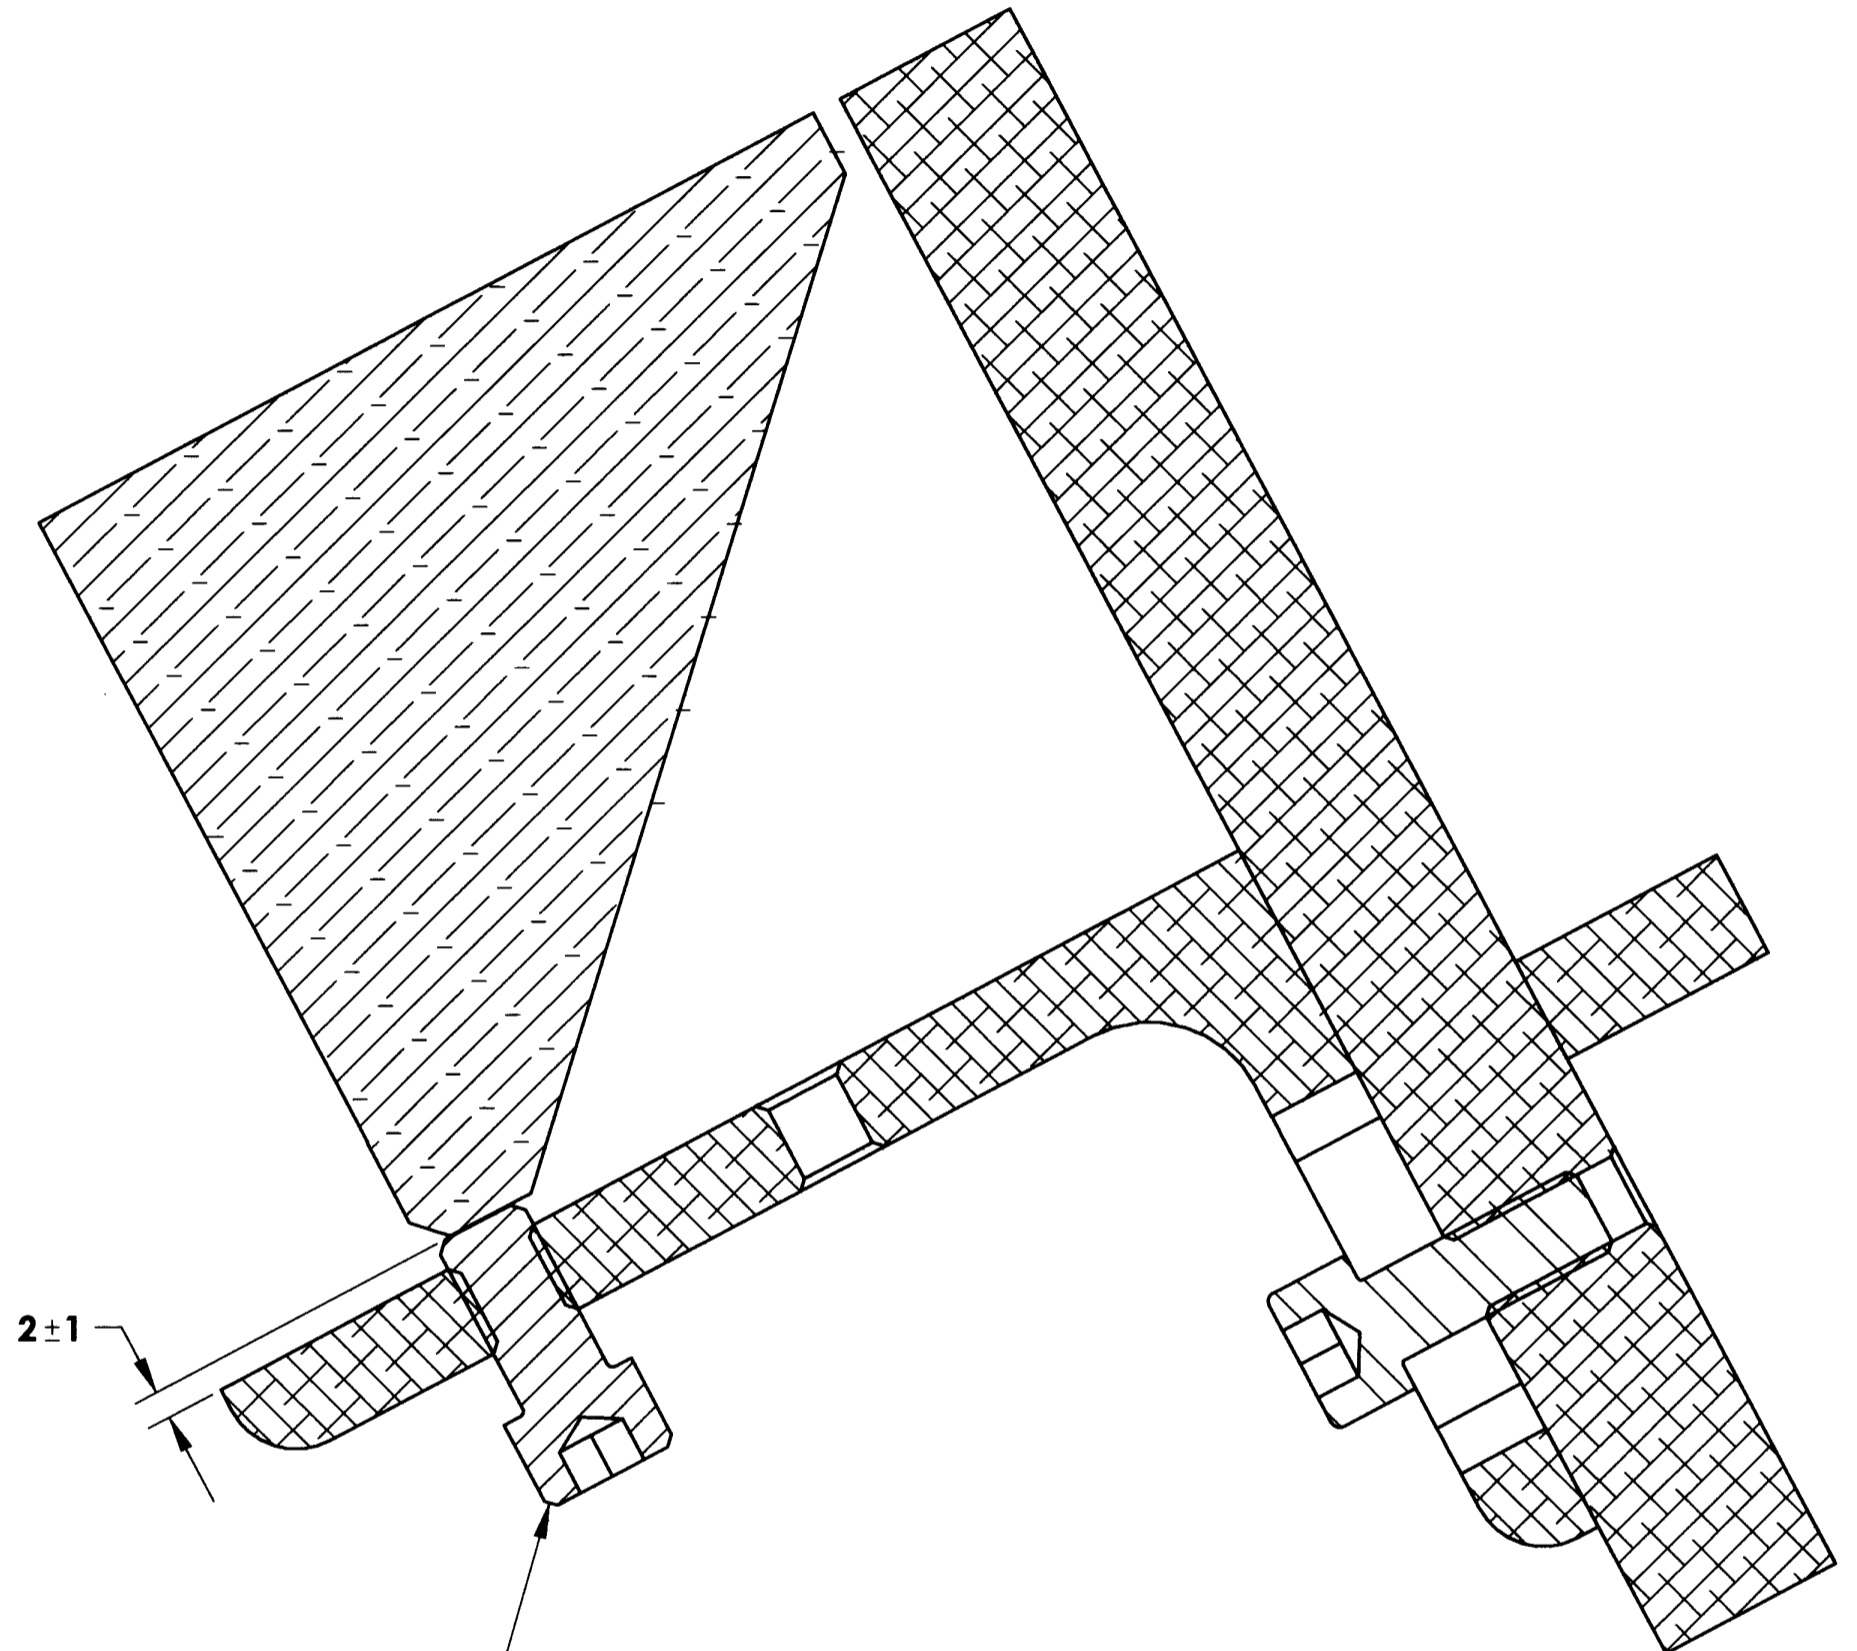

INSERT THE NYLON SCREW UNTIL IT JUST MAKES CONTACT WITH THE MIRROR. THIS WILL ALLOW THE MIRROR TO BE REMOVED AND REPLACED WITHIN ALLOWABLE LIMITS.

SECTION W-W
(SOME DETAILS NOT SHOWN FOR CLARITY)
SCALE 2 : 1

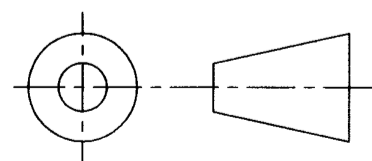

DO NOT SCALE DRAWING
DIMENSIONS IN MILLIMETERS

COPYRIGHT

THIS DOCUMENT & ENCLOSED PROPRIETARY INFORMATION REMAINS THE PROPERTY OF EOS TECHNOLOGIES, INC. THE INTELLECTUAL PROPERTY AND INFORMATION HEREIN MAY NOT BE COPIED NOR DISCLOSED WITHOUT WRITTEN CONSENT OF EOS TECHNOLOGIES, INC. MANAGEMENT



EOS TECHNOLOGIES, INC.
3160 E. TRANSCON WAY, SUITE 180, TUCSON, AZ 85706 PH: (520) 624-6399

TITLE: M3 MIRROR ASSEMBLY			
DRAWING NO. ASY-5671	STATUS Released	REVISION REL-02	SHEET SIZE A2
SCALE:1:2		SHEET 4 OF 5	